



Tech Info Library

Communications Interface Card: Manual Errata (11/96)

Revised: 11/21/96
Security: Everyone

Communications Interface Card: Manual Errata (11/96)

=====

Article Created: 19 May 1985
Article Reviewed/Updated: 18 November 1996

TOPIC -----

Listed below are corrections to the Communications Interface card manual
030-0008-01.

DISCUSSION -----

Corrections
=====

Page 17

The lower case info only applies to TERMINAL modes and the method to use it is not obvious. Also, the POKE 1784+n,160 causes the lower case to be displayed as FLASHING. POKE 1784+n,224 will cause lower case to be INVERSE.

Page 24

DATAMOVER will not work with Applesoft. It will require a complete re-write of the program.

Page 28

The Communications Card Print Routine was written when the only available DOS was version 3.1. POKE 845,110 will fix it to work with DOS 3.2 or DOS 3.3.

Page 36

The modification for 4800 baud in the manual is missing a wire. Add a wire from pin 15 of A1 to pin 15 of A2. Chip A1 is still not required.

Article Change History:

18 Nov 1996 - Reviewed for technical accuracy, revised formatting.

Copyright 1985-96. Apple Computer, Inc.

Tech Info Library Article Number:1138